

## **USING THE HIGHWAY SAFETY RESEARCH CENTER CHILD RESTRAINT RECALL LIST**

**Last Revisions – Newer Model List: February 1, 2008**  
**Older Model List: January 30, 2008**

### **About Child Restraints and Recalls**

It is very important to pay attention to recall notices and for parents to check if their seats are safe to use or if they need to be repaired or replaced. Recalls can be issued for any failure to meet Federal Motor Vehicle Safety Standard 213 established and enforced by the National Highway Traffic Safety Administration (NHTSA). Many recalls are issued due to reasons related to the crashworthiness of the child restraint, but some recalls are for deviations from the standards relating to labeling requirements, flammability of the upholstery or padding, or for parts that may come loose and pose a choking hazard.

Child restraints (CRs) are required to have a label indicating the manufacturer, model information, and date of manufacture. If the label is missing on a child restraint, the manufacturer should be contacted to see if the CR can be identified through other information. CRs should not be used if the model name, number, and date of manufacture cannot be determined.

Child restraint manufacturers have supplied registration cards with each new seat since 1993. It is important for the user to complete the registration card and send it to the manufacturer for quick notification in the event of a recall or safety notification. If the card for a restraint has been lost or if it was made before 1993, it can be registered by contacting the manufacturer through the phone numbers provided in the instructions and on the label on the seat.

Some recall notices are related to problems that do not make the restraints unsafe in a crash, but all problems should be corrected. Phone numbers are provided on the recall list when a corrective action can be taken. The manufacturer should be able to advise the parent whether to continue using the current restraint or to obtain another one until the problem can be corrected.

In cases where the manufacturer has gone out of business or discontinued replacement programs, parents are advised to destroy the seat and use another one. Unsafe seats should NOT be thrown in the trash where they can be picked up and used by others. Discarded seats should be destroyed by having them crushed. At the least, they should be taken apart and stripped of upholstery, padding and straps to prevent others from using them.

To report any suspected child restraint or vehicle safety defects, call the National Highway Traffic Safety Administration Auto Safety Hotline at 888-327-4236.

### **About Older Child Restraints and Recalls**

Child restraints manufactured before 1981 were not required to be crash tested and must not be used. Most child passenger safety advocates recommend that CRs older than ten years should be replaced by a new one. Note that some manufacturers and safety advocates recommend replacing CRs before 10 years and some child restraints are stamped with an expiration date. Parents and other caregivers are encouraged to contact the child restraint manufacturer for model specific recommendations.

Older models, those manufactured since 1981, are included as a part of the HSRC recall list because parents and other care givers will sometimes choose to use child restraints older than ten years even though it goes against the recommendations of most organizations and advocates. Knowing that a particular model is under recall, and if the defect can be corrected, should help to encourage the care giver to destroy the older CR and obtain a new one.

### **About the HSRC Recall List**

The UNC Highway Safety Research Center (HSRC) child restraint (CR) recall list identifies recalls and safety notifications for child restraint systems known by the HSRC at the time it is published and is updated by HSRC as soon as possible after recall notifications are announced. Users of this list can sign up for automatic email notification of updates to the HSRC recall list through the HSRC website at: [http://www.hsrc.unc.edu/pubinfo/child\\_recall\\_email.htm](http://www.hsrc.unc.edu/pubinfo/child_recall_email.htm).

The HSRC recall list is formatted in a relatively compact format without much detail, but does serve to indicate if a particular model has been recalled. Users of this list are encouraged to obtain more detailed information about recent recalls through the "Most Recent Car Seat Recall Announcements and Notices" page of the HSRC website at: [http://www.hsrc.unc.edu/pubinfo/child\\_recallrelease.htm](http://www.hsrc.unc.edu/pubinfo/child_recallrelease.htm).

The HSRC recall list is formatted with older models being separated from newer models. Recalls for models of child restraints where most or all of the effected units are 10 years old or older appear at the end of the list. A separate index for the older models precedes the list. The listing of older models with recalls will only be updated as "newer" models get to be old enough to be moved to the "older" models list.

The index listing numbers and page numbers for the older models section will stay the same until the older model section is updated or otherwise revised. Programs that make multiple copies of the list, e. g., for use at clinics or permanent checking stations, should only have to make copies of the older model section when it is revised regardless of how often the main (newer model) section is revised.

### **Instructions for Using the PDF Version of the HSRC Recall List**

Find the manufacturer, model name, model number, and date of manufacture on the label of the child restraint itself. Using this information:

- Look to see if the manufacturer and model name and/or model number are listed in the index. NOTE: Child restraints under recall are listed in the index by both model name and model number. Each entry on the list and in the index is assigned a "List #" based on its location in the list alphabetized by manufacturer and model name. List #'s for individual models will change in subsequent lists as models are added to or removed from the list.
- If that model name or model number is listed in the index, note the "List # (number)" and use the List # to locate the recall information for that model. Once located, check to see if the date range for the recall includes the date of manufacture listed on the label of the child restraint.
- If the restraint is included in the recall, the CR manufacturer should be contacted for verification of the recall and steps to take to correct the problem.
- If the manufacturer has gone out of business or discontinued their repair or replacement program, the CR should be destroyed after a replacement restraint is obtained.
- If the restraint is not included in the recall, inform the parent of this but still refer the parent to the manufacturer for verification of the restraint's recall status and to make sure it is registered with the manufacturer in case there is a recall issued on it in the future.

For further information, contact:

Bill Hall

The University of North Carolina Highway Safety Research Center

CB# 3430

Chapel Hill, NC 27599

919-962-2202 or (in NC) 800-672-4527 or [bill\\_hall@unc.edu](mailto:bill_hall@unc.edu)

The following lists identify recalls and safety notifications for child restraints (CRs) known by the UNC Highway Safety Research Center (HSRC) as of February 1, 2008. This list is updated by HSRC as soon as possible after recall notifications are announced. Updated versions are available on-line at [www.hsrc.unc.edu](http://www.hsrc.unc.edu) or by phone at 919-962-2202 or 800-672-4527 (in NC). The most recent addition(s) to the list is/are denoted by ">>".

CRs are required to have labels indicating the manufacturer, model name and number, and date of manufacture. Model names and numbers are listed for most of the recalls. Model numbers followed by one or more "x" should be read as "model numbers beginning with." If the label is missing on your CR, contact the manufacturer to see if it can be identified through other information. **A CR should not be used if its recall status cannot be determined because the model name, model number, date of manufacture or manufacturer is not available.**

CRs manufactured before 1981 were not required to be crash tested and must not be used. Most child passenger safety advocates recommend that CRs older than ten years should be replaced by a new one. Note that some manufacturers and safety advocates recommend replacing CRs before 10 years. **Models older than ten years and under recall are included on a separate list with a separate index.** The index for older models can be found following the last page of the "Models Less Than 10 Years Old" recall list and the list of older models with recalls follows the second index. **The "Models At Least 10 Years Old" list was last revised January 30, 2008.**

Some of the recalls/notifications for CRs on this list may be more or less date- or lot-specific than what is listed. More detailed information should be obtained through the manufacturer and **it is the manufacturer who can and should make the final determination if a specific CR is subject to recall.**

Some of the recall notices are related to problems that do not make the seats unsafe in a crash, but **all problems should be corrected.** Phone numbers are provided when a corrective action can be taken. The manufacturer should advise you whether to continue using your current CR or to obtain another one until the problem can be corrected.

**In cases where the manufacturer has gone out of business or discontinued replacement programs, you are advised to destroy the CR and obtain and use another one as soon as possible.** Do not throw unsafe models in the trash where they can be picked up and used by others. Discarded CRs should be destroyed by having them crushed. At the least, they should be taken apart and stripped of upholstery, padding and straps to prevent others from using them.

To report any suspected safety seat or vehicle safety defects, contact the National Highway Traffic Safety Administration Auto Safety Hotline: (888) 327-4236.

## CHILD RESTRAINTS LESS THAN 10 YEARS OLD

### Index of Recalls and Safety Notifications

Model numbers (noted by a "#") and model names for child restraints under recall are followed by their list number (that corresponds to the "List #" for each listing). Model numbers followed by an "x" should be read as "model numbers beginning with." If the model # is not found, check the model name also. Model #'s are not available for all model names.

<b>Alcot</b>	<b>Basic Comfort</b>	<b>Britax</b>	# E9W06 . . . . . 20
ALL MODELS . . . . . 1	# 960 . . . . . 7, 8	# 161 . . . . . 25	Advantage . . . . . 11
	# 961 . . . . . 7, 8	# E902228 . . . . . 11	Boulevard . . . . . 12
<b>All Our Kids</b>	Galaxy 2000 . . . . . 7, 8	# E9031 . . . . . 23, 24	Companion . . . . . 13, 14, 15
ALL MODELS . . . . . 2		# E906 . . . . . 20	Decathlon . . . . . 16
	<b>Beatrix Potter (Dorel)</b>	# E9L06 . . . . . 20	Husky . . . . . 17, 18
<b>Alpha Elite (Dorel)</b>	# 02-620-AZY . . . . . 9	# E9L07 . . . . . 27	Marathon . . . . . 19, 20
# 22331 BLA . . . . . 3, 4	# 02-620-BEA . . . . . 9	# E9L14 . . . . . 13, 14, 15	Regent . . . . . 21, 22
# 22332 RLA . . . . . 3, 4	# 02-621-SAL . . . . . 9	# E9L20 . . . . . 14, 15	Roundabout . . . . . 25
Comfort Infant Seat . . . . . 3, 4	Designer 22 . . . . . 9	# E9L30 . . . . . 17, 18, 19	Super Elite . . . . . 23, 24
		# E9L32 . . . . . 26	Traveller Plus . . . . . 26
<b>American Motors</b>	<b>Bolform</b>	# E9L398 . . . . . 21	Wizard . . . . . 27
ALL MODELS . . . . . 5	ALL MODELS . . . . . 10	# E9L39x . . . . . 22	
		# E9L47 . . . . . 16	<b>Century</b>
<b>Babyhood Industries</b>		# E9L57 . . . . . 12	# 44612 . . . . . 32
ALL MODELS . . . . . 6		# E9L80 . . . . . 14, 15	# 44622 . . . . . 29

<i>Century (continued)</i>	# 02-757	41	# 22630 LRS	52, 53	Discovery	59
# 44630	# 02-758	47	# 22631 LNG	52, 53	Embrace	60
# 44631	# 02-759	47	# 22740	57	Joyride	61
# 44662	# 02-760	47	# 22750	51	On My Way	62
# 44709	# 02-761	47	# 22755	51	On My Way base	63
# 45100	# 02-762	47	# 22756	51	Travel Tandem	64
# 45200	# 02-763	47	# 22757	51	Tribute	65
# 45600	# 02-764	47	# 22770	51	Triumph	66, 67
# 45700	# 02-765	47	3-in-1	49, 50	Two-in-One	68
# 4662	# 02-770	47	Alpha Omega	51	<b>Fisher Price</b>	
# 4875	# 02-771	47	Alpha Omega Elite	51	# 79700	69
# 4885	# 02-772	47	Comfort Infant Seat	52, 53	Safe Embrace	69
Accel	# 02-774	41	Deluxe 3-in-1	54		
Bravo	# 22-001FSM	43	Deluxe Convertible	55	<b>Ford [Aftermarket]</b>	
Breverra Contour	# 22-297	44	Designer 22	56	ALL MODELS	70
Breverra Premiere	# 22-298	44	Enspira	57	<b>Ford [Integrated]</b>	
Encore	# 22-299	44	<b>Evenflo</b>		Windstar	123
Smart Move	# 22-300-JOS GB1B	42	# 200x	62	<b>General Motors [Aftermarket]</b>	
	# 22100x	46	# 203x	61	ALL MODELS	71
<b>Childcare</b>	# 22111x	46	# 205x	61, 64	<b>Gerry</b>	
ALL MODELS	# 22130x	46	# 210x	61, 64	ALL MODELS	72
	# 22139MON	45	# 211x	62		
<b>Chrysler [Aftermarket]</b>	# 22150	39	# 264x	66, 67	<b>Graco</b>	
ALL MODELS	# 22155	39	# 272x	58	# 7493	73
	# 22180	39	# 273x	58	# 7497	73
<b>Chrysler [Integrated]</b>	# 22269	39	# 317xx	60	# 7499	73
Town and Country 115, 116, 117,	# 93100x	46	# 320xx	60	# 8402	74
118	# 93111x	46	# 359x	66	# 8402L	74
	Alpha Omega	38, 39	# 378x	65	# 8403x	74
<b>Collier-Keyworth</b>	Alpha Omega Elite	39	# 379x	65	# 841101	73
ALL MODELS	Arriva	38, 40, 41	# 389x	66	# 841102	73
	Designer 22	42	# 390	59	# 841103	73
<b>Combi</b>	DreamRide	43	# 391	59	# 8412	74
# 8100	High Rise Booster	44	# 397xx	60	# 841203	73
Avatar	Regal Ride	45	# 398xx	60	# 8412T02	73
	Touriva	46	# 435x	61	# 8433x	76
<b>Compass Baby</b>	Turnabout	47	# 447x	62	# 8442x	74
# 1420 ARD	<b>Dodge [Integrated]</b>		# 468x	58	# 8443	74
# 1420 FUO	Caravan 119, 120, 121, 122		# 469x	58	# 8443L	74
# 1420 MAR	Grand Caravan 119, 120, 121,		# 476x	58	# 8444	74
Infant Car Seat	122		# 477x	58	# 8444L	74
			# 478x	58	# 8446	74
<b>Cosco</b>	<b>Downunder</b>		# 480x	58	# 8446L	74
# 02-331	ALL MODELS	48	# 481x	58	# 8447	74
# 02-332	<b>Eddie Bauer</b>		# 493x	61	# 8447L	74
# 02-531	# 02-331	49	# 499x	62	# 8448	74
# 02-533	# 02-332	49	# 534	59	# 8448L	74
# 02-537	# 02-531	49	# 540xx	60	# 8457	73, 74
# 02-665	# 02-533	49	# 548xx	60	# 8458	73, 74
# 02-667	# 02-537	49	# 549xx	60	# 8459	73, 74
# 02-727	# 02-555	49	# 550xx	60	# 8460	73
# 02-728	# 22-625 AFD GB1B	56	# 552	59	# 8462	73
# 02-729	# 22-625 EDG GB1B	56	# 556xx	60	# 8463x	74
# 02-729 TED	# 22-625 GLC GB1B	56	# 597xx	60	# 8464	74
# 02-731	# 22-625 GLC GB1B	56	# 598xx	60	# 8464L	74
# 02-732	# 22-625 MAC GB1B	56	# 599xx	60	# 8470	74
# 02-733	# 22630 AFD	52, 53	# 636x	68	# 8471	73, 74
# 02-750	# 22630 BAL	52, 53	# 637x	68	# 8472	73
# 02-751	# 22630 FTM	52, 53	# 639001	63	# 8473	73
# 02-753	# 22630 HPN	52, 53	# 639002	63		
# 02-755	# 22630 LKM	52, 53	Cozy Carry	58		
# 02-756						

**Graco (continued)**

# 8474	73
# 8476	73
# 8477	73
# 8478	73, 74
# 8601	74
# 8602x	74
# 8603M	74
# 8605x	74
# 8607x	74
# 8608D	74
# 8609x	75
# 8616x	75
# 8629x	76
# 8630x	76
# 8631x	76
# 8632x	76
# 8635x	76
# 8639x	76
# 8643x	75
# 8645x	75
# 8646x	75
# 8C00x	76
# 8C01x	76
# 8C02x	76
# 8C03x	76
# 8C04x	76
# C844342	74
ComfortSport	76
SnugRide	73, 74, 75

**International**

ALL MODELS	77
------------	----

**Kolcraft**

# 1312x	80
# 1382x	80, 82, 83, 85
# 1383x	78, 80, 82, 83, 85
# 1384x	82, 83, 85
# 1385x	83, 85
# 368xx	80, 82, 83
# 43xxx	79, 84
# 77005	81
# 77007	81
Infant Car Seat	78
Infant Restraint	79
Infant Rider	80
Playskool Infant	81
Plus 4	82
Plus 5	83
Secura	84
Travel-About	85

**Lin Lih/MCP**

ALL MODELS	86
------------	----

**Mercedes-Benz**

# B66868203	89
# B66868204	89
# B66868209	89
# BQ6910155	88
# BQ6910157	87
# BQ691063	87
Booster Seat	87
Infant Restraint	88
Kiddy TopSafe	89

**Mia Moda**

# 5000	90
# 5001	90
Viva	90

**Peg Perego**

# AL33USL	92
# AL33USN	92
# AL34USL	92
# AL34USN	92
# CS00MU1	91, 92
# CS00US1	91, 92
# CS00US8	91, 92
# LN34S09	92
# LN34S10	92
# LV34USL	92
# LV34USN	92
# ST33USL	92
# ST33USN	92
# ST38USL	92
# ST38USN	92
Primo Viaggio	91, 92

**Playskool**

# 77005	93
# 77007	93
Infant Car Seat	93

**Plymouth [Integrated]**

Grand Voyager	124, 125, 126, 127
Voyager	124, 125, 126, 127

**Pride Trimble/Virco**

ALL MODELS	94
------------	----

**Questor**

ALL MODELS	95
------------	----

**Recaro**

# 331.00.xxx	96
Como	96

**Renolux (FBS)**

ALL MODELS	97
------------	----

**Safeline Kids**

# 2003	98
# 2240	99
# 3240	100
Sit'n'Stroll	98, 99, 100

**Safety 1st (Dorel)**

# 02-620-AZY	104
# 02-620-BEA	104
# 02-621-SAL	104
# 22-325 CMB GB1B	105
# 22-325 DTA GB1B	105
# 22-325 TST GB1B	105
# 22-325 VIN GB1B	105
# 22151	102
# 22450	107
# 22451	107
# 22452	107
# 22453	107
# 22455	102
# 22460	106
# 22480	107
# 22481	107
Alpha Elite	101
Alpha Omega	102
Alpha Omega Elite	102
Alpha Sport	103
Designer 22	104, 105
Enspira	107
Intera	106

**Snug Seat**

# 200-1000	108
# 600-1000	109
# E9L32	110
Gorilla	108
Spelcast	109
Traveller Plus	110

**Strolee**

ALL MODELS	111
------------	-----

**Team-Tex**

# 374099	112
Babyride	112

**TRW**

ALL MODELS	113
------------	-----

**XSCi**

Pioneered ACIS	114
----------------	-----

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>
			<i>Mfg Date Problem Type and Consumer Action</i>
1)	<b>Alcot (Childcare)</b>		<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i>
2)	<b>All Our Kids</b>		<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i>
	<b>Alpha Elite</b>		<b>Dorel Juvenile Group: 866-611-3022 / 800-544-1108 / 812-372-0141 www.djgusa.com</b>
3)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05- 02/28/06 Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit.
4)	Comfort Infant Seat	22331 BLA, 22332 RLA	07/26/05- 02/28/06 Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.
5)	<b>American Motors</b>		<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i>
6)	<b>Babyhood Industries</b>		<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i>
7)	<b>Basic Comfort</b>		<b>800-456-8687 - www.basiccomfort.com</b>
	Galaxy 2000	960, 961	ALL Crash test failure. Call mfg. for repair info.
8)	Galaxy 2000	960, 961	11/98- 1/99 Faulty molding of foam backs and cushions may allow separation of part of the booster seat. Call mfg. for repair info.
	<b>Beatrix Potter</b>		<b>Dorel Juvenile Group: 866-611-3022 / 800-544-1108 / 812-372-0141 www.djgusa.com</b>
9)	Designer 22	02-621-SAL, 02-620-AZY, 02-620-BEA	01/03/02- 02/13/02 Plastic handle can unexpectedly release from the carrying position when used as a carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.
10)	<b>Bolform Corp.</b>		<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i>
	<b>Britax</b>		<b>888-427-4829 / 704-409-1700 - www.britaxusa.com</b>
11)	Advantage	E902228	03/05/01- 07/26/01 One of the tether brackets of affected seats may separate from the tether attachment point. Contact mfg. for repair kit.
12)	Boulevard	E9L57	03/01/06- 08/01/06 Top tether hook can open during a crash allowing the restraint to change from an upright to a reclined position. Owners are being advised to discontinue use of the top tether when the child reaches 50 lbs. Contact mfg. for replacement labels.
13)	Companion	E9L14	10/31/03- 06/06/04 One or both of two tabs on the bottom of the carrier may not be properly seated and may allow the carrier to rotate in the base too far in a crash. Correct/incorrect assembly can be determined by visual examination. Call mfg. for replacement info. Affected units may be installed without the base until receiving a replacement.
14)	Companion	E9L14, E9L20, E9L80	Pre- 11/01/07 User Guide Update - NOT A RECALL: Britax has updated instructions regarding adjustment of the buckle strap position and maximum height for infant carrier use. The inner buckle strap position should be used for infants weighing less than 11 pounds. A child has exceeded the height limit for the Companion when the top of the head is less than one inch from the top of the child restraint or the child's height exceeds 30 inches (76 cm). Contact mfg for updated user guide and labels

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<b><i>Britax (continued)</i></b>				
15)	Companion	E9L14, E9L20, E9L80	All	Consumer Advisory - NOT A RECALL: Britax advises that the user should adjust the carrier handle so that it is completely down and behind the carrier after installation in the vehicle with or without the base assembly. Contact mfg. for additional info.
16)	Decathlon	E9L47	02/12/05-07/31/07	Under certain circumstances the harness adjuster housing may separate from the child restraint shell and allow the adjuster to move out of position. If this happens caregivers may experience difficulty adjusting the harness. Call mfg. for repair info.
17)	Husky	E9L30	08/01/02-12/31/03	Head excursions higher than allowed by FMVSS 213 could result when installed as instructed with a long/serpentine belt path. Contact mfg. for replacement labels advising the use of an alternative short belt path.
18)	Husky	E9L30	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
19)	Marathon	E9L06	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
20)	Marathon	E9L06, E9W06, E906 with top tether lot # KGR 01 A	05/23/06-07/28/06	The top tether hook may open and have the potential to release from the tether anchor if the child exceeds 50 pounds. Contact mfg. for repair kit.
21)	Regent Classic	E9L3998	12/18/06-01/18/07	Affected seats were produced with an incorrect airbag warning label attached to the cover. Contact mfg. to receive a free replacement cover.
22)	Regent	E9L39x	11/10/05-06/18/07	Consumer Advisory/Product Update - NOT A RECALL: Britax has modified the Regent and revised the installation instructions. Contact mfg. to receive a free product update kit that includes a revised user guide, replacement belt-routing label, a longer LATCH connector strap, and adhesive slip resistant strips.
23)	Super Elite	E9031	04/25/01-02/15/02	Harness may allow too much forward head movement. Contact mfg. to receive a free replacement harness system.
24)	Super Elite	E9031	04/01/01-08/31/02	Harness adjuster tab may begin to stick after prolonged use. Harness may loosen if it sticks in the open position. Contact mfg. for repair kit and installation instructions.
25)	Roundabout	161	1/99-3/99	Possible faulty molding of shell can allow excessive head excursion. Call mfg. for repair info.
26)	Traveller Plus (Mfg. by Britax for Snug Seat)	E9L32	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
27)	Wizard	E9L07	Pre-07/24/04	The adjuster strap may slip within the metal buckle that controls the tightness of the shoulder harness and may allow the harness to loosen. Contact mfg. for repair kit.
<b><i>Century Products</i></b>			<b><i>800-837-4044 / 216-468-2000 - www.gracobaby.com</i></b>	
28)	Accel	45100, 45200, 45600, 45700	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
29)	Bravo	44622, 44630, 44631, 44662	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
30)	Brevera Contour	4875	2/95-7/98	Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
31)	Brevera Premiere	4885	2/95-7/98	Product improvement campaign: Buckle for the harness can crack or break. Call mfg. for replacement information.
32)	Encore	44612, 4662	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.
33)	Smart Move	44709	04/09/01-05/10/01	Harness adjustment lock may allow webbing to slip during a serious crash when used in the forward facing mode for some models and lot codes. Call Century at 1-800-575-6097 for replacement info.

<i>List #</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>
<i>Model Name</i>	<i>Mfg Date</i>	<i>Problem Type and Consumer Action</i>
34)	<b>Chrysler</b>	<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i>
35)	<b>Collier-Keyworth</b>	<i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i>
	<b>Combi USA</b>	<b>800-992-6624 / 803-548-6633 - <a href="http://www.combi-intl.com">www.combi-intl.com</a></b>
36)	Avatar 8100	11/12/03- Lower latch anchorage does not meet dynamic test requirements of FMVSS 213. 05/07/04 Contact mfg. for free in-home repair kit and instructions. Affected models should be installed with the vehicle seat belt. Do not use the seat with the latch until repairs are made.
	<b>Compass Baby</b>	<b>888-899-2229 - <a href="http://www.compassbaby.com">www.compassbaby.com</a></b>
37)	Infant Car Seat I420 ARD I420 FUE I420 MAR	05/07/06, The metal slide crotch anchor can become dislodged allowing excessive movement 05/13/06, of the child and cracking of the plastic shell. This problem was discovered during and testing by the manufacturer. There have been no reports of injuries and no calls from 05/15/06 consumers regarding problems. Contact mfg. for free repair kit.
	<b>Cosco</b>	<b>Dorel Juvenile Group: 866-611-3022 / 800-544-1108 / 812-372-0141 <a href="http://www.djgusa.com">www.djgusa.com</a></b>
38)	Alpha Omega 02-331, 02-332, 02-531, 02-533, 02-537, 02-555.	11/17/00- Tether webbing could be cut and separate in a crash allowing excessive movement 01/10/01 of the child. Contact mfg. for free repair kit.
39)	Alpha Omega 22150, 22180, 22269 Alpha Omega 22155 Elite	11/01/03- There is a potential for the harness adjustment strap to loosen during use. Contact 12/31/05 mfg. for free repair kit.
40)	Arriva 02-729 TED	03/31/99- Airbag warning label is missing on seat pad. Fabric color noted by "TED" is only one 04/07/99 affected. Call mfg. for replacement pad.
41)	Arriva 02-665, 02-727, 02-728, 02-729, 02-731, 02-732, 02-733, 02-750, 02-751, 02-755, 02-756, 02-757, 02-774	03/01/95- Handle locks can unexpectedly release when used as a carrier, causing the seat to 01/31/00 flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]
42)	Designer 22 22-300-JOS GB1B	08/19/03- Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents 10/20/04 should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
43)	DreamRide 22-001FSM	12/01/03- Failed to meet back support angle requirements of FMVSS 213. 04/28/04 Discontinue rear-facing use and use only as a car bed or request free replacement rear-facing child restraint from DJG. Contact mfg. for warning label and information.
44)	High Rise 22-297, 22-298, 22-299 Booster	10/01/03- Incorrect warning label stating it is for use forward facing for children under one year 10/31/03 of age rather than OVER one year of age. Contact mfg. for free replacement label and instructions.
45)	Regal Ride 22139MON	09/28/04- Elastic straps on padding can come loose and become accessible to the child 09/20/07 allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit.
>> 46)	Touriva 22100x, 22111x, 22130x, 93100x, 93111x	09/28/04- Elastic straps on padding can come loose and become accessible to the child 09/20/07 allowing the child to loop the elastic strap around portions of his/her body. Contact mfg. for repair kit.



<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>
			<i>Mfg Date Problem Type and Consumer Action</i>
<b><i>Cosco (continued)</i></b>			
47)	Turnabout	02-667, 02-753, 02-756, 02-758, 02-759, 02-760, 02-761, 02-762, 02-763, 02-764, 02-765, 02-770, 02-771, 02-772	03/01/95-01/31/00 Handle locks can unexpectedly release when used as a carrier, causing the seat to flip forward. Does not affect safety as car seat. Call mfg. for repair info. [Note: a recall campaign initiated 06/25/03 added models made through 01/31/00 to a previous recall of those made through 09/97.]
48)	<b><i>Downunder</i></b>		<b><i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i></b>
	<b><i>Eddie Bauer</i></b>		<b><i>Dorel Juvenile Group: 866-611-3022 / 800-544-1108 / 812-372-0141 www.djgusa.com</i></b>
49)	3-in-1	02-331, 02-332, 02-531, 02-533, 02-537, 02-555	11/17/00-01/10/01 Tether webbing could be cut and separate in a crash allowing excessive movement of the child. Contact mfg. for free repair kit.
50)	3-in-1	All Models	11/01/03-12/31/05 There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
51)	Alpha Omega Alpha Omega Elite	22750 22755, 22756, 22757, 22770	11/01/03-12/31/05 There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
52)	Comfort Infant Seat	22631 LNG, 22630 AFD, 22630 BAL, 22630 FTM, 22630 HPN, 22630 LRS, 22630 LKM.	07/26/05-02/28/06 Trim screws on handle can loosen resulting in a potential choking hazard. Contact mfg. at 877-229-1374 for free repair kit. Make sure the handle trim screws are tight and continue to use the existing seat while waiting to receive and install the repair kit. (The 22630 models are part of the 01726 Eddie Bauer Integrated Travel System.)
53)	Comfort Infant Seat	22631 LNG, 22630 AFD, 22630 BAL, 22630 FTM, 22630 HPN, 22630 LRS, 22630 LKM.	07/26/05-02/28/06 Some consumers have experienced difficulty installing the base in certain vehicles. Dorel will replace the original version of the base at no charge to the customer. Contact mfg. at 877-229-1374 to determine eligibility for a replacement base.
54)	Deluxe 3-in-1	All Models	11/01/03-12/31/05 There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
55)	Deluxe Convertible	All Models	11/01/03-12/31/05 There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
56)	Designer 22	22-625 AFD GB1B 22-625 GLC GB1B 22-625 EDG GB1B 22-625 MAC GB1B	08/19/03-10/20/04 Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
57)	Enspira	22740	11/01/03-12/31/05 There is a potential for the harness adjustment strap to loosen during use. Contact mfg. for free repair kit.
	<b><i>Evenflo</i></b>		<b><i>800-525-2472 / 800-233-5921 / 800-490-7497 - www.eventflo.com</i></b>
58)	Cozy Carry	272x, 273x, 468x, 469x, 476x, 477x, 478x, 480x, 481x	ALL (11/01/01-08/31/02) Upgrade Kit - Not a Recall: For owners of Cozy Carry infant car seats to improve the performance of the detachable base in certain types of collisions. The kit is only for detachable bases with the words "Cozy Carry" on them. Visit www.cozycarry.com or call 800-582-6698 for free kit.
>>59)	Discovery	390, 391, 534, 552	Pre-02/01/08 Voluntary Safety Recall - Testing showed that the car seat could potentially become separated from its base in high impact side collisions. Contact mfg. for free supplemental dual-hook fastener for enhanced safety performance.
60)	Embrace	Begins with 317, 320, 397, 398, 540, 548, 549, 550, 556, 597, 598, 599	Pre-04/08/06 When used as an infant carrier, the handle can unexpectedly release, causing the seat to rotate forward. Handle should not be used until the repair kit has been installed. Affected restraints can continue to be used as a car seat properly installed in a vehicle. Contact mfg. for a free repair kit.
61)	Joyride	Begins with 203, 205, 210, 435, 493	01/88-12/98 When used as an infant carrier, the carry handle can unexpectedly release, cause he seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>
<i>Model Name</i>	<i>Model #</i>	<i>Mfg Date Problem Type and Consumer Action</i>

**Evenflo (continued)**

- |     |                                |                                |                   |   |
|-----|--------------------------------|--------------------------------|-------------------|---|
| 62) | On My Way                      | Begins with 200, 211, 447, 499 | Pre-02/10/00      | Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.   |
| 63) | On My Way base                 | 639001, 639002                 | Pre-02/10/00      | Safety Notification: Alignment posts in base can become bent after repeated use. Contact mfg. for free upgrade kit.   |
| 64) | Travel Tandem (Joyride + base) | 205x, 210x                     | 01/88-12/98       | When used as an infant carrier, the carry handle can unexpectedly release, cause the seat to flip forward, and cause infant to fall to the ground. Call mfg. for repair info.   |
| 65) | Tribute                        | 378x, 379x                     | 09/08/05-09/22/05 | Certain areas of the plastic shell may be prone to stress fractures. Call mfg. to receive a replacement seat.   |
| 66) | Triumph                        | 264x, 359x, 389x               | 09/06/01-10/31/05 | Portions of the cloth cover can be pulled back exposing the foam liner in an area that is reachable by a child occupant. A child inside the seat may break off and potentially choke on a piece of the foam liner. Contact mfg. for repair kit. |
| 67) | Triumph                        | 264x                           | 10/20/01-01/31/02 | Slide loop connectors in the harness may not be strong enough to fully secure the child in a crash. Call mfg. for repair kit.   |
| 68) | Two-in-One                     | 636x, 637x                     | 1/98-3/98         | In crash tests, the seat's backrest and base have separated when 5-point harness was being used. Call mfg. for information and replacement seat.  |

**Fisher Price****800-432-5437 - [www.fisher-price.com](http://www.fisher-price.com)**

- |     |              |       |           |  |
|-----|--------------|-------|-----------|--|
| 69) | Safe Embrace | 79700 | 5/97-3/98 | Harness adjuster. Call mfg. for repair info. |
|-----|--------------|-------|-----------|--|

**70) Ford****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE****71) General Motors****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE****72) Gerry****REFER TO OLDER MODELS LIST - ALL MODELS WITH RECALLS ARE OLDER THAN 10 YEARS****Graco****800-345-4109 - [www.gracobaby.com](http://www.gracobaby.com)**

- |        |              |   |                   |  |
|--------|--------------|---|-------------------|--|
| 73)    | SnugRide #'s | 7493, 7497, 7499, 841101, 841102, 841103, 841203, 8412T02, 8457, 8458, 8459, 8460, 8462, 8471, 8472, 8473, 8474, 8476, 8477, 8478 See Note  | 08/31/99-02/28/02 | May be missing 1 or 2 metal hooks and their retainer pins on the base of the carrier shell or the "U" shaped bars on the carrier shell that are used to attach the carrier to the base. If the hooks, pins or "U" bars are missing, the carrier may not be securely attached to the base and the carrier could detach from the base in the event of a sudden stop or crash. Call Graco to receive a free replacement seat or base. NOTE: All affected model numbers may also begin with the letter "A" and/or also be followed by letters. |
| 74)    | SnugRide #'s | 8402, 8402L, 8403x, 8412, 8442x, 8443, 8443L, 8444, 8444L, 8446, 8446L, 8447, 8447L, 8448, 8448L, 8457, 8458, 8459, 8463x, 8464, 8470, 8471, 8478, 8601, 8602x, 8603M, 8605x, 8607x, 8608D, C844342 | 03/01/02-03/08/03 | May have missing hardware used to attach the carrier to the base. Contact mfg. at 866-473-0163 or <a href="http://www.gracobaby.com">www.gracobaby.com</a> for inspection and repair information. All models can safely be installed without the base. [NOTE: The initial 03/12/03 recall campaign for this problem included models manufactured through 03/06/03. A recall extension announced 08/13/03 added models manufactured through 03/08/03.]  |
| >> 75) | SnugRide     | 8609x, 8616x, 8643x, 8645x, 8646x   | 08/01/06-06/30/07 | The backing of the seat pad may pull away from the seams in an area reachable to the child occupant, exposing the pad filling and posing a potential choking hazard. Contact mfg. For repair kit.  |
| 76)    | ComfortSport | 8629x, 8630x, 8631x, 8632x, 8635x, 8639x, 8C00x, 8C01x, 8C02x, 8C03x, 8C04x, 8433x  | 01/02/07-07/31/07 | Lower Anchorage belt may have been misrouted during assembly process. Use the vehicle seatbelt instead of LATCH to install affected models in the rear-facing position until it is inspected and, if necessary, corrected. Call mfg. or visit <a href="http://gracobaby.com">gracobaby.com</a> website for additional info.  |

**77) International****REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

<i>List #</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>
<i>Model Name</i>		<i>Mfg Date Problem Type and Consumer Action</i>
<b>Kolcraft</b>		<b>800-453-7673 / 312-247-4494</b>
78)	Infant Car Seat 1383x	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
79)	Infant Restraint 43xxx	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
80)	Infant Rider 1312x, 1382x, 1383x, 368xx	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
81)	Playskool Infant Car Seat 77005, 77007	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
82)	Plus 4 1382x, 1383x, 1384x, 368xx	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
83)	Plus 5 1382x, 1383x, 1384x, 1385x, 368xx	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
84)	Secura 43xxx	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
85)	Travel-About 1382x, 1383x, 1384x, 1385x	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
86)	<b>Lin Lih/MCP Ent.</b>	<b>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>
<b>Mercedes-Benz USA</b>		<b>800-367-6372 - www.mbusa.com</b>
87)	Booster BQ6910157, BQ6910163	02/01/97-07/31/99 BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.
88)	Infant Restraint BQ6910155	02/01/97-07/31/99 BabySmart airbag deactivation device may not automatically deactivate the passenger airbag. Contact mfg. for free replacement seat and instructional video.
89)	Kiddy TopSafe (mfg. by Sicartex) B66868203 B66868204 B66868209	03/01/03-11/30/03 Lower LATCH attachment may not be strong enough to hold in the event of a crash. Immediately replace with another model and return Kiddy Top seat to Mercedes-Benz dealer for refund. Install with vehicle seat belt until replacement is obtained. Contact Mercedes-Benz for further information.
<b>Mia Moda</b>		<b>866-642-6632 - www.miamodainc.com</b>
>> 90)	Viva 5000, 5001	12/19/06-02/06/07 The lower anchor connector adjuster assembly may interfere with the connection of the infant carrier to the restraint base when installed using LATCH. Installation with seat belt is not affected. In addition, registration cards were not provided with the Viva or separately sold bases. Contact mfg. For repair kit and to register CR with mfg.
<b>Peg Perego USA</b>		<b>877-737-3468 / 219-482-8191 - www.perego.com</b>
91)	Primo Viaggio CS00MU1, CS00US1, CS00US8	02/01/01-06/10/01 The latch mechanism securing the seat to the base does not completely engage on a small number of seats due to improper positioning of the metal reinforcement bracket. Call mfg. for repair info. Note: Primo Viaggio infant seat sold separately and with strollers as part of Pliko and Primo Viaggio Travel Systems.
92)	Primo Viaggio CS00MU1, CS00US1, CS00US8, LV34USL, LV34USN, LN34S09, LN34S10, ST33USL, ST33USN, ST38USL, ST38USN, AL33USL, AL33USN, AL34USN, AL34USL	05/20/01-02/15/02 The harness adjustment/locking mechanism may not fully lock and allow the harness to slip. The strap tension adjuster cover of affected models have a red circle around a dark button. Contact mfg, for full identification and repair information. Note: Primo Viaggio infant seat sold separately and with strollers as a part of Pliko, Primo Viaggio, and Atlantico Travel Systems.

<i>List #</i>	<i>Manufacturer Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>
<i>Model Name</i>		<i>Mfg Date Problem Type and Consumer Action</i>
<b>Playskool</b>		
93)	Infant Car Seat 77005, 77007	1/93-6/99 Carrier handle can release and allow the seat to rotate. Does not affect safety as car seat. Call mfg. for repair info.
94)	<b>Pride Trimble/Virco</b>	REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE
95)	<b>Questor</b>	REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE
<b>Recaro</b>		
>> 96)	Como 331.00.xxx	800-873-2276 / 248-364-3818 - <a href="http://www.recaro-nao.com">www.recaro-nao.com</a> Pre- Consumer Advisory - Not a Recall: Lap and shoulder belt guide (previously referred to as "lock-off") may not hold belt webbing snugly enough to prevent belt from loosening. Contact mfg. for locking clip and instructions included as a part of the consumer advisory.
97)	<b>Renolux (FBS)</b>	REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE
<b>Safeline Kids</b>		
98)	Sit'n'Stroll 2003	800-829-1625 - <a href="http://www.tripleplayproducts.com">www.tripleplayproducts.com</a> 09/01/02- Child's head may move too far forward in a crash when lower forward-facing belt path or shoulder and buckle pads are used. Remove and discard shoulder and buckle pads and use upper forward-facing belt path only. Contact mfg. for revised instructions and labels. 10/21/03
99)	Sit'n'Stroll 2240	04/01/01- The FAA certification statement on label is in yellow lettering instead of the required RED lettering. Flight attendants may not allow its use on an airplane. Contact mfg. for replacement label. 10/01/01
100)	Sit'n'Stroll 3240	11/1/96- Labels recommend use rear-facing for children up to 25 pounds. Contact Mfg. for new labels to be placed over the existing labels. New labels recommend use rear-facing for children up to 22 pounds. 6/30/99
<b>Safety 1st</b>		
Dorel Juvenile Group: 866-611-3022 / 800-544-1108 / 812-372-0141 <a href="http://www.djgusa.com">www.djgusa.com</a>		
101)	Alpha Elite All Models	11/01/03- There is a potential for the harness adjustment strap to loosen during use. Contact 12/31/05 mfg. for free repair kit.
102)	Alpha Omega 22151 Alpha Omega 22455 Elite	11/01/03- There is a potential for the harness adjustment strap to loosen during use. Contact 12/31/05 mfg. for free repair kit.
103)	Alpha Sport All Models	11/01/03- There is a potential for the harness adjustment strap to loosen during use. Contact 12/31/05 mfg. for free repair kit.
104)	Designer 22 02-621-SAL, 02-620-AZY, 02-620-BEA	01/03/02- Plastic handle can unexpectedly release from the carrying position when used as a 02/13/02 carrier. Does not affect safety as a child restraint. Contact mfg. for repair kit.
105)	Designer 22 22-325 CMB GB1B 22-325 VIN GB1B 22-325 DTA GB1B 22-325 TST GB1B	08/19/03- Harness can loosen if not properly tightened. Contact mfg. for free repair kit. Parents 10/20/04 should continue to use the seat while waiting to receive/install the repair kit but are advised to make sure that the seat is properly adjusted while in use. NOTE: Models involved were sold only as travel systems (with a stroller) and any line code other than GB1B in the model # is not included in the recall.
106)	Intera 22460	11/01/03- There is a potential for the harness adjustment strap to loosen during use. Contact 12/31/05 mfg. for free repair kit.
107)	Enspira 22450, 22451, 22452, 22453, 22480, 22481	11/01/03- There is a potential for the harness adjustment strap to loosen during use. Contact 12/31/05 mfg. for free repair kit.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance</i>
			<b>Mfg Date Problem Type and Consumer Action</b>
	<b><i>Snug Seat</i></b>		<b><i>800-336-7684 - www.snugseat.com</i></b>
108)	Gorilla	200-1000	07/26/02- A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. 01/15/03 Contact mfg. for replacement kit # FW-50250-12-ZY
109)	Spelcast	600-1000	07/26/02- A washer in tether anchor kit does not meet corrosion requirements of FMVSS 213. 01/15/03 Contact mfg. for replacement kit # FW-50250-12-ZY
110)	Traveller Plus (Mfg. by Britax for Snug Seat)	E9L32	Pre- The adjuster strap may slip within the metal buckle that controls the tightness of the 07/24/04 shoulder harness and may allow the harness to loosen. <u>Contact Britax</u> at 800-683-2045 or 704-409-1700 for repair kit.
111)	<b><i>Strolee</i></b>		<b><i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i></b>
	<b><i>Team-Tex America</i></b>		<b><i>877-912-1313</i></b>
>> 112)	Babyride	374099	08/31/06- Belt routing label with "horizontal reference line" was incorrectly placed on the CR. 10/23/06 Contact mfg. for a correct label and placement instructions. NOTE: According to Team-Tex America, all seats that were affected by this recall were caught and corrected before being purchased by consumers and thus should not be found in use.
113)	<b><i>TRW</i></b>		<b><i>REFER TO OLDER MODELS LIST - ALL MODELS ARE OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</i></b>
	<b><i>XSCi</i></b>		<b><i>800-630-6850 / 719-593-8881</i></b>
114)	Pioneered ACIS	None*	02/01/02- Exceeds the maximum head excursion criteria of FMVSS 213. In a crash, the cradle 03/07/02 can detach from the deflector base. Contact mfg for replacement information (replacements produced by an alternate mfg.) *No model number is associated, but affects serial numbers 01C-000000002 to 01C-000000108. [NHTSA No.: 02E-024] **NOTE: According to XSCi, all seats that were affected by this recall have been returned (as of May 8, 2002) and thus should not be found in use.**

<i>Integrated (built-into the vehicle) seats</i>					
<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model Year</i>	<i>Mfg Date</i>	<i>Customer assistance Problem Type</i>	<i>and Consumer Action</i>
<b>Chrysler</b>			<b>800-853-1403 / 800-992-1997</b>		
115)	Town and Country	1996		Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair	
116)	Town and Country	1988		Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.	
117)	Town and Country	1996, 1997		Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate	
118)	Town and Country	1996, 1997		The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.	
<b>Dodge</b>			<b>800-853-1403 / 800-992-1997</b>		
119)	Caravan Grand Caravan	1996		Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair	
120)	Caravan Grand Caravan	1988		Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.	
121)	Caravan Grand Caravan	1996, 1997		Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate	
122)	Caravan Grand Caravan	1996, 1997		The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.	
<b>Ford</b>			<b>800-392-3673</b>		
123)	Windstar	1998		The headrest lockout mechanism on the integrated child seats may not engage and lock the headrest in the "down" position, as intended. Replace bench seats with integrated child seats with seats built with revised headrest lockout mechanisms.	
<b>Plymouth</b>			<b>800-853-1403 / 800-992-1997</b>		
124)	Voyager Grand Voyager	1996		Bolts securing seat to frame can break. Contact Chrysler Corp. or dealer for repair	
125)	Voyager Grand Voyager	1988		Harness restraint webbing incorrectly routed around the metal reinforcement bar on these seats. Child may not be properly restrained in the event of a crash. Dealers will inspect and correct improperly routed webbing.	
126)	Voyager Grand Voyager	1996, 1997		Safety improvement campaign: The latch plate can remain in the locked position due to food or other items. Owners are being provided with decals/instructions describing the operation of the buckle and the latch plate	
127)	Voyager Grand Voyager	1996, 1997		The harness on the integrated child seat can become difficult to release when the safety belt latch plate gets dirty. Dealers will clean the latch, modify the emergency release anchor, and provide additional instructions.	

Child restraints (CRs) manufactured before 1981 were not required to be crash tested and must not be used. Most child passenger safety advocates recommend that CRs older than ten years should be replaced by a new one. Note that some manufacturers and safety advocates recommend replacing CRs before 10 years. **Following are recalls and safety notifications that were issued for models where all or most models sold are at least 10 years old as of January 30, 2008.** Updated versions of this list and a listing of recalls on models less than 10 years old are posted on-line at [www.hsrb.unc.edu](http://www.hsrb.unc.edu).

## CHILD RESTRAINTS AT LEAST 10 YEARS OLD

### Index of Recalls and Safety Notifications

Model numbers (noted by a "#") and model names for child restraints under recall are followed by their list number (that corresponds to the "List #" for each listing). Model numbers followed by an "x" should be read as "model numbers beginning with." If the model # is not found, check the model name also. Model #'s are not available for all model names.

<b>Alcot (Childcare)</b>	# 4210 . . . . . 212, 213, 214, 215	# 4551 . . . . . 241	<b>Chrysler</b>
Child Love Seat . . . . . 200	# 4214 . . . . . 212, 213, 214, 215	# 4557 . . . . . 241	Child Love Seat . . . . . 245
	# 4223 . . . . . 212, 213, 214, 215	# 4558 . . . . . 241	
<b>All Our Kids</b>	# 4235 . . . . . 212, 213, 214, 215	# 4559 . . . . . 241	<b>Collier-Keyworth</b>
# 600 . . . . . 201	# 4253 . . . . . 216, 217, 218	# 4560 . . . . . 240	Co-Pilot . . . . . 246
# 602 . . . . . 202	# 4261 . . . . . 217, 218	# 4564 . . . . . 241	Commuter . . . . . 248
Little Cargo Vest . . . . . 201, 202	# 4263 . . . . . 216, 217, 218	# 4565 . . . . . 240, 241	Safe and Sound II . . . . . 247
	# 4265 . . . . . 216, 217, 218	# 4566 . . . . . 241	
<b>American Motors</b>	# 4266 . . . . . 217, 218	# 4568 . . . . . 241	<b>Cosco</b>
Child Love Seat . . . . . 204	# 4300 . . . . . 219	# 4569 . . . . . 241	# 02-014-EMF . . . . . 263
Infant Love Seat . . . . . 203	# 4302 . . . . . 219	# 4575 . . . . . 238, 241	# 02-014-GDM . . . . . 263
	# 4303 . . . . . 219	# 4576 . . . . . 241	# 02-015-PDL . . . . . 263
<b>Babyhood Industries</b>	# 4310 . . . . . 219	# 4580 . . . . . 237	# 02-084 . . . . . 262, 265
# 810 . . . . . 205	# 4323 . . . . . 219	# 4581 . . . . . 236, 237	# 02-086 . . . . . 250
# 8200 . . . . . 206	# 4334 . . . . . 219	# 4583 . . . . . 236, 237	# 02-090 . . . . . 259
Baby-Sitter . . . . . 206	# 4335 . . . . . 219	# 4585 . . . . . 236, 237	# 02-094 . . . . . 265
Wonda Chair . . . . . 205	# 4353 . . . . . 221, 222, 224	# 4589 . . . . . 241	# 02-096 . . . . . 265
	# 4365 . . . . . 221, 222, 223, 224	# 4590 . . . . . 240	# 02-190 . . . . . 261
<b>Bolform Corp.</b>	# 4365DT . . . . . 220	# 4591 . . . . . 241	# 02-290 . . . . . 260
# 84E-019 . . . . . 207	# 4366 . . . . . 220, 221, 222, 223, 224	# 4593 . . . . . 241	# 02-404 . . . . . 265
Buckle-Up Harness . . . . . 207	# 4367 . . . . . 223, 224	# 4594 . . . . . 241	# 02-514-BWE . . . . . 264
	# 4368 . . . . . 221, 222, 223, 224	# 4595 . . . . . 241	# 02-518-NDF . . . . . 264
<b>Britax</b>	# 4369 . . . . . 223, 224	# 4597 . . . . . 241	# 02-584-OXF . . . . . 264
# 101 . . . . . 208	# 4380 . . . . . 223, 225	# 4600 . . . . . 239	# 02-719 ARQ . . . . . 251
Freeway . . . . . 208	# 4381 . . . . . 223	# 4750 . . . . . 244	# 02-751 . . . . . 249
	# 4400 . . . . . 228, 229	100 . . . . . 209, 210	# 02-790 . . . . . 252
<b>Century</b>	# 4434 . . . . . 228, 229	1000 STE . . . . . 211	# 02-821 . . . . . 265
# 11-564 . . . . . 227	# 4436 . . . . . 228, 229	200 . . . . . 212, 213, 214, 215	# 02-890 . . . . . 252
# 11-565 . . . . . 227	# 4446 . . . . . 228, 229	2000 STE . . . . . 216, 217, 218	# 181A . . . . . 253
# 11-570 . . . . . 226, 227	# 4450 . . . . . 230, 231, 233, 234	300 . . . . . 219	# 181B . . . . . 253
# 11-575 . . . . . 227	# 4460 . . . . . 230, 231, 232, 233, 234	3000 STE . . . . . 220, 221, 222, 223, 224	# 313 . . . . . 255
# 11-576 . . . . . 227	# 4470 . . . . . 231, 232, 233, 234	3500 STE . . . . . 225	# 323 . . . . . 256
# 11-578 . . . . . 227	# 4475 . . . . . 230, 231, 232, 233, 234	4-In-1 . . . . . 226, 227	# 423 . . . . . 256
# 11-595 . . . . . 227	# 4476 . . . . . 232, 233	400XL . . . . . 228, 229	# 81A . . . . . 253
# 11-597 . . . . . 226, 227	# 4480 . . . . . 232, 235	5000 STE . . . . . 230, 231, 232, 233, 234	# 81B . . . . . 253
# 11-598 . . . . . 227	# 4490 . . . . . 232, 235	5500 STE . . . . . 235	Arriva . . . . . 249
# 11-599 . . . . . 227	# 4500 . . . . . 242	580 . . . . . 236, 237	Commuter . . . . . 250
# 11-600 . . . . . 226, 227	# 4510 . . . . . 242	Affinity . . . . . 238	Dream Ride . . . . . 251
# 11-650 . . . . . 226	# 4513 . . . . . 241	Child Love Seat . . . . . 239	Lxry Sft Shld Auto Trac . . . . . 252
# 12-565 . . . . . 241	# 4515 . . . . . 241	Infant Car Seat . . . . . 240, 241	Safe and Easy . . . . . 255
# 4100 . . . . . 209, 210	# 4516 . . . . . 241	Infant Love seat . . . . . 242	Safe and Snug . . . . . 256
# 4153 . . . . . 211	# 4518 . . . . . 241	Smart Fit . . . . . 243	Safe-T Mate . . . . . 254
# 4163 . . . . . 211	# 4520 . . . . . 242	Smart Move . . . . . 244	Safe-T-Shield . . . . . 253
# 4180 . . . . . 211	# 4525 . . . . . 243		Sft Shld Auto Trac . . . . . 260
# 4200 . . . . . 212, 213, 214, 215	# 4535 . . . . . 240		Soft Shield . . . . . 259

<b>Cosco (continued)</b>	# 471 . . . . . 272, 273	# 180-150 . . . . . 323, 324	<b>Safeline Kids</b>
Soft Shield Deluxe . . . . . 261	# 492x . . . . . 282	# 180-200 . . . . . 317, 318, 324, 325	# 3240 . . . . . 365
Touriva . . . . . 262, 263, 264, 265	410 . . . . . 269	# 180-300 . . . . . 317, 318	Sit'n'Stroll . . . . . 365
Voyager Inf/Stroller . . . . . 267	Bobby Mac Champion . . . . . 270	# 180-400 . . . . . 328	<b>Strolee</b>
<b>Downunder</b>	Bobby Mac Deluxe . . . . . 271	# 180-600 . . . . . 315, 319	# 599 . . . . . 367
Kangaroo Booster . . . . . 268	Booster Seat . . . . . 272, 273	# 180-601 . . . . . 315	# 605 . . . . . 369
<b>Evenflo</b>	Champion . . . . . 274, 275, 276	# 19127 . . . . . 321, 322	# 609 . . . . . 368
# 201 . . . . . 280	Dyn-O-Mite . . . . . 277, 278	# 19128 . . . . . 321	# 610 . . . . . 368
# 202 . . . . . 278, 280	Infant Car Seat . . . . . 279, 280	# 19129 . . . . . 321	GT 3000 . . . . . 370
# 205x . . . . . 288	On My Way . . . . . 281, 282	# 19130 . . . . . 321	Quick Click . . . . . 369
# 206 . . . . . 281	One-Step . . . . . 283	# 368xx . . . . . 320, 330, 331, 336	Wee Care . . . . . 366, 367, 368
# 207x . . . . . 282	One-Step Deluxe . . . . . 284	# 77001 . . . . . 329	<b>TRW</b>
# 219164 . . . . . 289	Scout . . . . . 257, 285	# 77002 . . . . . 329	Child Love Seat . . . . . 372
# 219180 . . . . . 289	Seven Year Seat . . . . . 286, 287	Automate . . . . . 315	Infant Love Seat . . . . . 371
# 219186 . . . . . 289	Sidekick . . . . . 258	Carter Travel 5 . . . . . 316	<b>Volvo</b>
# 219188 . . . . . 289	Travel Tandem . . . . . 288	Dial-A-Fit . . . . . 317, 318	All . . . . . 373
# 21940 . . . . . 289	Trooper . . . . . 266, 289	Dial-A-Fit II . . . . . 319	
# 219x . . . . . 257, 266, 276	Ultara 1 . . . . . 290, 291	Flip 'N' Go . . . . . 321	
# 221 . . . . . 283	Ultara II . . . . . 292, 293	Flip 'N' Go II . . . . . 322	
# 222 . . . . . 284	<b>Fisher Price</b>	Infant Rider . . . . . 320	
# 223 . . . . . 284	# 9100 . . . . . 294, 295, 296, 297, 298,	Perfect Fitt . . . . . 323, 324, 325	
# 224x . . . . . 257, 266, 274, 275, 276	299, 300, 301, 302	Performa . . . . . 326, 327	
# 225x . . . . . 257, 266, 276	# 9101 . . . . . 295, 296, 298, 299, 300,	Playskool . . . . . 328, 329	
# 227 . . . . . 292	301, 302	Plus 4 . . . . . 330	
# 228 . . . . . 287	# 9104 . . . . . 303, 306, 307	Plus 5 . . . . . 331, 332	
# 229x . . . . . 257, 266, 276, 285	# 9149 . . . . . 304	Rock 'N' Ride . . . . . 333, 334	
# 231 . . . . . 291	# 9173 . . . . . 305	Secure Fit . . . . . 335	
# 232 . . . . . 293	Booster . . . . . 306, 307	Travel About . . . . . 336, 337	
# 242 . . . . . 273	Car Seat . . . . . 294, 295, 296, 297,	Traveler 700 . . . . . 338, 339, 340	
# 244x . . . . . 258	298, 299, 300, 301, 302	<b>Lin Lih/MCP</b>	
# 401 . . . . . 283	Delux Car Seat . . . . . 303	# 180-200 . . . . . 342	
# 402 . . . . . 283	Infant Seat . . . . . 304, 305	# 180-300 . . . . . 342	
# 403 . . . . . 283	<b>Ford</b>	Lin Lih . . . . . 341, 342	
# 404 . . . . . 283	Infant Love Seat . . . . . 308	<b>Playskool</b>	
# 405 . . . . . 283	<b>General Motors</b>	# 140-155 . . . . . 343	
# 406 . . . . . 283	Child Love Seat . . . . . 310	# 180-400 . . . . . 343	
# 407 . . . . . 283	Infant Love Seat . . . . . 309	# 77001 . . . . . 344	
# 408 . . . . . 283	<b>Gerry</b>	# 77002 . . . . . 344	
# 409 . . . . . 283	# 626 . . . . . 312	Car Seat . . . . . 343, 344	
# 410 . . . . . 269	Guardian . . . . . 311	<b>Pride Trimble/Virco</b>	
# 411 . . . . . 270	Secure Ride . . . . . 312	# 832 . . . . . 347	
# 412 . . . . . 271	<b>Graco</b>	# 890 . . . . . 345, 346	
# 414 . . . . . 271	GT 1000 . . . . . 313	# 891 . . . . . 345, 346	
# 415 . . . . . 271	<b>International</b>	# 892 . . . . . 345, 346	
# 416 . . . . . 271	Astroseat . . . . . 314	Click-n-Go . . . . . 345, 346	
# 4176 . . . . . 284	<b>Kolcraft</b>	Pride Ride . . . . . 347	
# 420 . . . . . 290	# 131-101 . . . . . 334	<b>Questor</b>	
# 441 . . . . . 277, 278, 280	# 13123 . . . . . 333	Kantwet Car Seat . . . . . 348	
# 442 . . . . . 277, 278, 280	# 13833 . . . . . 316, 332, 337	<b>Renolux (FBS)</b>	
# 443 . . . . . 277, 278, 280	# 13842 . . . . . 316, 332, 337	GT 1000 . . . . . 349	
# 444 . . . . . 277, 278, 280	# 13852 . . . . . 316, 332, 337	GT 2000 . . . . . 350, 351, 352	
# 445 . . . . . 277, 278, 280	# 138xx . . . . . 320, 330, 331, 336	GT 4000 . . . . . 353, 354	
# 446 . . . . . 277, 278, 280	# 140-155 . . . . . 328	GT 5000 . . . . . 355, 356	
# 447 . . . . . 277, 278	# 150-100 . . . . . 339	GT 5000 Turn A Tot . . . . . 357, 358,	
# 448 . . . . . 277, 278, 280	# 180-100 . . . . . 323	359	
# 453 . . . . . 286, 287		GT 5500 . . . . . 360, 361	
# 454 . . . . . 286, 287		GT 7000 . . . . . 362, 363, 364	
# 456 . . . . . 279, 280			
# 458 . . . . . 279, 280			
# 470 . . . . . 272, 273			



<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<b>Alcot (Childcare)</b>				
<b>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>				
200)	Child Love Seat		3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
<b>All Our Kids</b>				
<b>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>				
201)	Little Cargo Vest	600	4/93-3/94	Flammability of upholstery. Call mfg. for repair info.
202)	Little Cargo Vest	602	3/94-9/94	Flammability of upholstery. Call mfg. for repair info.
<b>American Motors</b>				
<b>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>				
203)	Infant Love Seat		1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
204)	Child Love Seat		3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
<b>Babyhood Industries</b>				
<b>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>				
205)	Wonda Chair	810	Pre 12/82	Harness may be misrouted. Call mfg. for instructions.
206)	Baby-Sitter	8200	1/92-6/93	Buckle. Call mfg. for repair info.
<b>Bolform Corp.</b>				
<b>ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY &amp; REPLACE</b>				
207)	Buckle-Up Harness	84E-019	ALL	Crash test failure. Destroy & replace.
<b>Britax</b>				
<b>888-427-4829 / 704-409-1700</b>				
<b>www.britaxusa.com</b>				
208)	Freeway	101	6/96-4/97	Buckle. Call mfg. for repair info.
<b>Century Products</b>				
<b>800-837-4044 / 216-468-2000</b>				
209)	100	4100	1/81-4/81	Upholstery buttons. Call mfg. for repair info.
210)	100	4100	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
211)	1000 STE	4153, 4163, 4180	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
212)	200	4200, 4210, 4235, 4214, 4223	1/81-4/81	Upholstery buttons. Call mfg. for repair info.
213)	200	4200, 4210, 4235, 4214, 4223	June 81	Washers on frame. Call mfg. for repair info.
214)	200	4200, 4210, 4235, 4214, 4223	1/81-1/83	Buckle. Call mfg. for repair info.
215)	200	4200, 4210, 4235, 4214, 4223	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
216)	2000 STE	4253, 4263, 4265	4/84-6/89	Harness. Call mfg. for repair info.
217)	2000 STE	4253, 4261, 4263, 4265, 4266	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
218)	2000 STE	4253, 4261, 4263, 4265, 4266	12/91-4/92	Buckle. Call mfg. for repair info.
219)	300	4300, 4302, 4303, 4323, 4310, 4334, 4335	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
220)	3000 STE	4365DT, 4366	3/89-10/89	Upholstery. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

**Century Products (continued)**

221)	3000 STE	4353, 4365, 4366, 4368	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
222)	3000 STE	4353, 4365, 4366, 4368	Pre 91	Buckle instructions. Call mfg. for corrections
223)	3000 STE	4365, 4366, 4367, 4368, 4369, 4380, 4381	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
224)	3000 STE	4353, 4365, 4366, 4367, 4368, 4369	10/89-4/92	Buckle. Call mfg. for repair info.
225)	3500 STE	4380	12/90-4/92	Buckle. Call mfg. for repair info.
226)	4-In-1 Travel System	11-570, 11-597, 11-600, 11-650	9/95-5/96	Buckle. Call mfg. for repair info.
227)	4-In-1 Travel System	11-564, 11-565, 11-570, 11-575, 11-576, 11-578, 11-595, 11-597, 11-598, 11-599, 11-600	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
228)	400XL	4400, 4434, 4436, 4446	4/85-2/86	Plastic shell may crack in crash. Call mfg. for repair info.
229)	400XL	4400, 4434, 4436, 4446	11/84-4/86	Shield. Call mfg. for repair info.
230)	5000 STE	4450, 4460, 4475	12/88-11/89	Buckle. Call mfg. for repair info.
231)	5000 STE	4450, 4460, 4470, 4475	5/90-6/90	Crash test failure of buckle. Call mfg. for repair info.
232)	5000 STE	4460, 4470, 4475, 4476, 4480, 4490	12/90-10/91	Incorrect labels on seat. Call mfg. for corrections
233)	5000 STE	4450, 4460, 4470, 4475, 4476	09/89-4/92	Buckle. Call mfg. for repair info.
234)	5000 STE	4450, 4460, 4470, 4475,	Pre 91	Buckle instructions. Call mfg. for corrections.
235)	5500 STE	4480, 4490	01/91-4/92	Buckle. Call mfg. for repair info.
236)	580	4581, 4583, 4585	6/86-10/89	Screws for carry handle. Call mfg. for repair info.
237)	580	4580, 4581, 4583, 4585	7/86-12/89	Incorrect instructions. Call mfg. for corrections.
238)	Affinity Infant Seat	4575	9/95-5/96	Buckle. Call mfg. for repair info.
239)	Child Love Seat	4600	3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
240)	Infant Car Seat	4535, 4560, 4565, 4590	9/95-5/96	Buckle. Call mfg. for repair info.
241)	Infant Car Seat	12-565, 4513, 4515, 4516, 4518, 4551, 4557, 4558, 4559, 4564, 4565, 4566, 4568, 4569, 4575, 4576, 4589, 4591, 4593, 4594, 4595, 4597	01/01/91-07/31/97	Handle can break when the seat is used as an infant carrier causing the infant to fall to the ground be injured. Does not affect safety as car seat. Call 800-865-1419 for replacement handle.
242)	Infant Love seat	4500, 4510, 4520	1/81-12/82	Plastic shell may develop cracks. Destroy & replace seat.
243)	Smart Fit	4525	9/95-5/96	Buckle. Call mfg. for repair info.
244)	Smart Move	4750	11/95-2/96	Buckle. Call mfg. for repair info.

**Chrysler****ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

245)	Child Love Seat		3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
------	-----------------	--	------------	---

**Collier-Keyworth****800-544-1108**

246)	Co-Pilot		82-83	Shield. Call mfg. for repair info.
------	----------	--	-------	------------------------------------

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

**Collier-Keyworth (continued)**

247)	Safe and Sound II		12/84-4/85	Buckle. Call mfg. for repair info.
248)	Commuter		10/87-02/88	Padding. Call mfg. for repair info.

**Cosco**

249)	Arriva	02-751	03/95-05/95	Buckle. Call mfg. for repair info.
250)	Commuter	02-086	11/87-2/88	Upholstery/padding. Call mfg. for repair info.
251)	Dream Ride	02-719 ARQ	01/89-01/94	Upholstery flammability. Call mfg. for repair info.
252)	Luxury Soft Shield Auto Trac	02-790, 02-890	10/89-6/90	Crash test failure. Call mfg. for repair info.
253)	Safe-T-Shield	81A or B, 181A or B	10/80-6/83	Shield. Call mfg. to replace seat.
254)	Safe-T Mate		1984	Wrong instructions. Call mfg. for repair info.
255)	Safe and Easy	313	1/84-6/85	Plastic shell. Call mfg. for repair info.
256)	Safe and Snug	323, 423	1/84-6/85	Plastic shell. Call mfg. for repair info.
257)	Scout	219x, 224x, 225x, 229x	10/96-02/97	Crash test failure. Call mfg. for repair info.
258)	Sidekick Booster	244x	04/96-5/97	Crash test failure of shield. Use only as belt-positioning booster. Call mfg. for refund info.
259)	Soft Shield	02-090	10/89-6/90	Crash test failure. Call mfg. for repair info.
260)	Soft Shield Auto Trac	02-290	10/89-6/90	Crash test failure. Call mfg. for repair info.
261)	Soft Shield Deluxe	02-190	10/89-6/90	Crash test failure. Call mfg. for repair info.
262)	Touriva	02-084	5/94-8/94	Buckle. Call mfg. for repair info.
263)	Touriva Shield	02-014-EMF, 02-014-GDM, 02-015-PDL	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.
264)	Touriva 5-point	02-514-BWE, 02-584-OXF, 02-518-NDF	8/97 (Mold #3)	Crash test failure of shell in front-facing recline position. Call mfg. for repair info.
265)	Touriva T-Shield	02-084, 02-094, 02-096, 02-404, 02-821	5/96-11/97	Crash test failure of post-test release pressure standard for the buckle. Call mfg. for repair info.
266)	Trooper	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
267)	Voyager Infant Seat/Stroller		9/97-10/97	Potential dislodgement from stroller. Does not affect safety as car seat. Call mfg. for repair info.

**Downunder**

268)	Kangaroo Booster Seat		Pre- 1/98 (AI)	Safety improvement campaign: The shoulder belts may not be properly located when the child is placed in the restraint. The shoulder belt guides may not help achieve correct seat belt placement. Do not use this booster if the shoulder belt does not touch the child's chest.
------	-----------------------	--	----------------	--

**No longer in business****Evenflo****800-525-2472 / 800-233-5921**

269)	410	410	6/88-4/89	Harness/shield. Call mfg. for repair info.
270)	Bobby Mac Champion	411	4/85-4/90	Buckle. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

**Evenflo (continued)**

271)	Bobby Mac Deluxe	412, 414, 415, 416	4/85-4/90	Buckle. Call mfg. for repair info.
272)	Booster Seat	470, 471	2/87-8/88	Upholstery buttons. Call mfg. for repair info.
273)	Booster Seat	242, 470, 471	4/85-4/90	Buckle. Call mfg. for repair info.
274)	Champion	224x	06/93-11/96	Crash test failure. Call mfg. for repair info.
275)	Champion	224x	06/93-11/96	Crash test failure. Call mfg. for repair info.
276)	Champion	219x, 224x, 225x, 229x	10/96-2/97	Crash test failure. Call mfg. for repair info.
277)	Dyn-O-Mite	441 thru 448	1/85-1/89	Crash test failure. Call mfg. for repair info.
278)	Dyn-O-Mite	202, 441 thru 448	4/85-4/90	Buckle. Call mfg. for repair info.
279)	Infant Car Seat	456, 458	Pre 4/89	Crash test failure. Call mfg. for repair info.
280)	Infant Car Seat	201, 202, 441 thru 446, 448, 456, 458	4/85-4/90	Buckle. Call mfg. for repair info.
281)	On My Way	Begins with 206	05/94-05/95	Crash test failure. Call mfg. for repair info.
282)	On My Way	Begins with 207, 492	12/95-07/97	When used as a carrier, the locking mechanism on the handle can slip, flipping the seat forward and tossing the baby on the ground. Call mfg. for repair info.
283)	One-Step	221, 401 thru 409	04/85-04/90	Buckle. Call mfg. for repair info.
284)	One-Step Deluxe	222, 223, 4176	04/85-04/90	Buckle. Call mfg. for repair info.
285)	Scout	229x	06/93-12/96	Crash test failure. Call mfg. for repair info.
286)	Seven Year Seat	453, 454	02/87-08/88	Upholstery buttons. Call mfg. for repair info.
287)	Seven Year Seat	228, 453, 454	04/85-04/90	Buckle. Call mfg. for repair info.
288)	Travel Tandem (Joyride + base)	205x	01/88-03/96	Test failure with base. Use without base and call mfg. for repair info.
289)	Trooper (shield)	21940, 219164, 219180, 219186, 219188	11/95-1/96	Instructions. Call mfg. for new instructions
290)	Ultara 1	420	9/88-7/89	Buckle. Call mfg. for repair info.
291)	Ultara 1	231	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.
292)	Ultara II	227	1/90-6/90	Crash test failure. Call mfg. for repair info.
293)	Ultara II	232	2/93-8/93	Plastic sleeve on harness. Call mfg. for repair info.

**Fisher Price****800-355-8882 / 800-433-5437 / 716-687-3934**

294)	Car Seat	9100	Pre-1987	Harness/shield. Call mfg. for repair info.
295)	Car Seat	9100, 9101	4/85-1/89	Upholstery. Call mfg. for repair info.
296)	Car Seat	9100, 9101	2/90-3/90	Buckle. Call mfg. for repair info.
297)	Car Seat	9100	4/85-8/85	Shield. Call mfg. for repair info.
298)	Car Seat	9100, 9101	5/87-1/89	Buckle. Call mfg. for repair info.
299)	Car Seat	9100, 9101	2/89-11/89	Buckle (extended 5/87-1/89). Call mfg. for repair info.
300)	Car Seat	9100, 9101	Pre 91	Loose button. Call mfg. for repair info.
301)	Car Seat	9100, 9101	2/91-1/92	Harness/shield. Call mfg. for repair info.
302)	Car Seat	9100, 9101	Pre 7/89	Label on shield. Call mfg. for repair info.
303)	Delux Car Seat	9104	6/15-9/92	Buckle. Call mfg. for repair info.
304)	Infant Seat	9149	1/91-2/91	Shield. Call mfg. for repair info.
305)	Infant Seat	9173	9/94-10-94	Air bag label. Call mfg. for repair info.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
<b>Fisher Price (continued)</b>				
306)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.
307)	Booster	9104	4/92-9/92	Buckle. Call mfg. for repair info.
<b>Ford</b>				
<b>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>				
308)	Infant Love Seat		81/82	Plastic shell may develop cracks. Destroy & replace seat.
<b>General Motors</b>				
<b>ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY &amp; REPLACE</b>				
309)	Infant Love Seat		81/82	Plastic shell may develop cracks. Destroy & replace seat.
310)	Child Love Seat		3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.
<b>Gerry</b>				
<b>Contact Evenflo: 800-525-2472 / 800-233-5921</b>				
311)	Guardian		01/90-05/90	Buckle. Call mfg. for repair info.
312)	Secure Ride	626	08/94-03-95	Air bag label. Call mfg. for new label
<b>Graco</b>				
<b>800-345-4109 / www.gracobaby.com</b>				
313)	GT 1000		1/85-1/86	Crash test failure. Call mfg. for repair info.
<b>International</b>				
<b>ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY &amp; REPLACE</b>				
314)	Astroseat		12/80-7/81	Buckle. Destroy & replace seat.
<b>Kolcraft</b>				
<b>800-453-7673 / 312-247-4494</b>				
315)	Automate	180-600, 180-601	Pre 4/93	Buckle. Call mfg. for repair info.
316)	Carter Travel 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
317)	Dial-A-Fit	180-200, 180-300	1/87-8/89	Upholstery clips. Call mfg. for repair info.
318)	Dial-A-Fit	180-200, 180-300	10/88-8/89	Crash test failure. Call mfg. for repair info.
319)	Dial-A-Fit II	180-600	11/90-8/91	Crash test failure. Call mfg. for repair info.
320)	Infant Rider	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
321)	Flip 'N' Go	19127 thru 19130	1/85-3/87	Shield. Call mfg. for repair info.
322)	Flip 'N' Go II	19127	1/85-3/88	Shield. Call mfg. for repair info.
323)	Perfect Fitt	180-100, 180-150	Pre 4/90	Upholstery clips. Call mfg. for repair info.
324)	Perfect Fitt	180-150, 180-200	3/89-10/90	Crash test failure. Call mfg. for repair info.
325)	Perfect Fitt	180-200	Pre 10/90	Upholstery. Call mfg. for repair info.
326)	Performa		3/96-10-96	Upholstery. Call mfg. for repair info.
327)	Performa		1/96-7/97	Buckle release force. Call mfg. for repair info.
328)	Playskool Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call mfg. for repair info.
329)	Playskool Car Seat	77001, 77002	1/91-6/93	Buckle. Call mfg. for repair info.
330)	Plus 4	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
331)	Plus 5	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
332)	Plus 5	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
333)	Rock 'N' Ride	13123	2/85-6/85	Plastic shell. Call mfg. to replace seat.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

**Kolcraft (continued)**

334)	Rock 'N' Ride	131-101	Pre 3/90	Upholstery clips. Call mfg. for repair info.
335)	Secure Fit		1/96-7/97	Buckle release force. Call mfg. for repair info.
336)	Travel About	138xx, 368xx	3/96-8/96	Crash test failure of buckle. Call mfg. for repair info.
337)	Travel About	13833, 13842, 13852	5/96-9/96	Crash test failure of buckle. Call mfg. for repair info.
338)	Traveler 700	All	11/01/94-12/31/95	Voluntary action: Buckle concerns. Call mfg. for repair info.
339)	Traveler 700	150-100	1/91-8/91	Cracks in plastic. Call mfg. to replace seat.
340)	Traveler 700	All	1/91-6/93	Rusting of buckle. Call mfg. for repair info.

**Lin Lih/MCP Ent.****ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

341)	Lin Lih		ALL	Counterfeit seat. Call NHTSA: 800-424-9393
342)	Lin Lih	180-200, 180-300	10/88-8/89	Crash test failure. Call NHTSA: 800-424-9394

**Playskool****Contact Kolcraft: 800-453-7673**

343)	Car Seat	140-155, 180-400	12/89-8/90	Upholstery. Call Kolcraft
344)	Car Seat	77001, 77002	1/91-6/93	Buckle. Call Kolcraft

**Pride Trimble/Virco****800-521-5198**

345)	Click-n-Go	890, 891, 892	2/86-10/87	Crash test failure. Call mfg. to replace seat.
346)	Click-n-Go	890, 891, 892	1/88-4/89	Crash test failure. Call mfg. to replace seat.
347)	Pride Ride	832	1/88-4/89	Crash test failure. Call mfg. to replace seat.

**Questor****Contact Evenflo: 800-233-5921**

348)	Kantwet Car Seat		5/69-3/73	May pinch child's fingers. Call mfg. for repair info.
------	------------------	--	-----------	---

**Renolux (FBS)****ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

349)	GT 1000		8/88-10/88	Buckle/recline angle. Destroy & replace seat.
350)	GT 2000		8/88-10/88	Buckle/recline angle. Destroy & replace seat.
351)	GT 2000		1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
352)	GT 2000		5/89-6/93	Flammability of upholstery. Destroy & replace seat.
353)	GT 4000		1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
354)	GT 4000		5/89-6-93	Flammability of upholstery. Destroy & replace seat.
355)	GT 5000		1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
356)	GT 5000		5/89-6-93	Flammability of upholstery. Destroy & replace seat.
357)	GT 5000 Turn A Tot		2/90-4/91	Test failure/upholstery. Destroy & replace seat.
358)	GT 5000 Turn A Tot		1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
359)	GT 5000 Turn A Tot		5/89-6-93	Flammability of upholstery. Destroy & replace seat.
360)	GT 5500		1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
361)	GT 5500		5/89-6-93	Flammability of upholstery. Destroy & replace seat.
362)	GT 7000		All	Remote may overheat/ fire hazard. Destroy & replace seat.

<i>List #</i>	<i>Manufacturer Model Name</i>	<i>Model # ("X" = more numbers or letters follow)</i>	<i>Customer assistance Mfg Date</i>	<i>Problem Type and Consumer Action</i>
---------------	--------------------------------	---	-------------------------------------	---

**Renolux / FBS (continued)**

363)	GT 7000		1/92-1/93	Foam padding failed HIC (head injury) limits. Destroy & replace seat.
364)	GT 7000		5/89-6-93	Flammability of upholstery. Destroy & replace seat.

**Safeline Kids**

**800-829-1625**  
**www.tripleplayproducts.com**

365)	Sit'n'Stroll	3240	6/9/97-8/9/97	Air bag labels. The air bag warning label was omitted from the seat cover. Contact Mfg. for new seat cover that has the required air bag warning label.
------	--------------	------	---------------	---

**Strolee**

**ALL MODELS OLDER THAN 10 YEARS - NO LONGER IN BUSINESS - DESTROY & REPLACE**

366)	Wee Care	All	Pre 4/80	Crash test failure. Destroy & replace seat.
367)	Wee Care	599	12/80-5/81	Upholstery. Destroy & replace seat.
368)	Wee Care	609, 610	ALL	Plastic shell. Destroy & replace seat.
369)	Quick Click	605	ALL	Plastic shell. Destroy & replace seat.
370)	GT 3000		87/88	Crash test failure. Destroy & replace seat.

**TRW**

**ALL MODELS OLDER THAN 10 YEARS - REPLACEMENT PROGRAM DISCONTINUED - DESTROY & REPLACE**

371)	Infant Love Seat		81/82	Plastic shell may develop cracks. Destroy & replace seat.
372)	Child Love Seat		3/84-11/84	Plastic shell may develop cracks. Destroy & replace seat.

**Volvo**

**800-458-1552 / 800-221-9136 / 201-768-7300**

373)	ALL SEATS		Thru 12/88	Buckle. Call mfg. for refund info.
------	-----------	--	------------	------------------------------------

